



	Rect1	Ref.
Emiss.	1.0	1.0
Avg	14.5 °C	
Min	6.7 °C	
Max	34.9 °C	11.5 °C
Delta	23.4 °C	

Equipment	H1 bushing connection.
Location	North and South transformer
Condition	Overheating
Causes	Loose, dirty, or corroded connection.
Load	Unknown
Temperature Rise	23.4°C
Repair Priority Level	Level 4: Major discrepancy; repair immediately.
Action Suggested	Inspect, clean, and tighten connection.
Repairs Completed By:	

Repairs Completed On:	
-----------------------	--

Date: 4/05/2007	Thermographer: Mark Whitledge
-----------------	-------------------------------